



XJ range

DATE 02/06

XJ501-22

**SERVICE**

**TECHNICAL BULLETIN**

**Broken Center Console Lid Handle –  
XJ With 4-Zone Climate Control Only –  
Replace Latch**

MODEL 2004 MY-ON  
XJ range  
VIN G00001-ON

**Issue:**

Some 2004 MY-ON XJ range vehicles may exhibit a broken center console lid handle. This condition is caused by deformation of the clipping points on the latch of the centre console lid used with the 4-Zone climate control system.

**Action:**

In case of a customer complaint of the above condition, replace the console lid latch only instead of the complete center console lid. Follow the Service Instruction outlined below.

SERVICE INSTRUCTION

1. Open center console lid.

**NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR DEALER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.**



- Carefully release the two retaining clips and remove the console lid latch (Illustration 1).

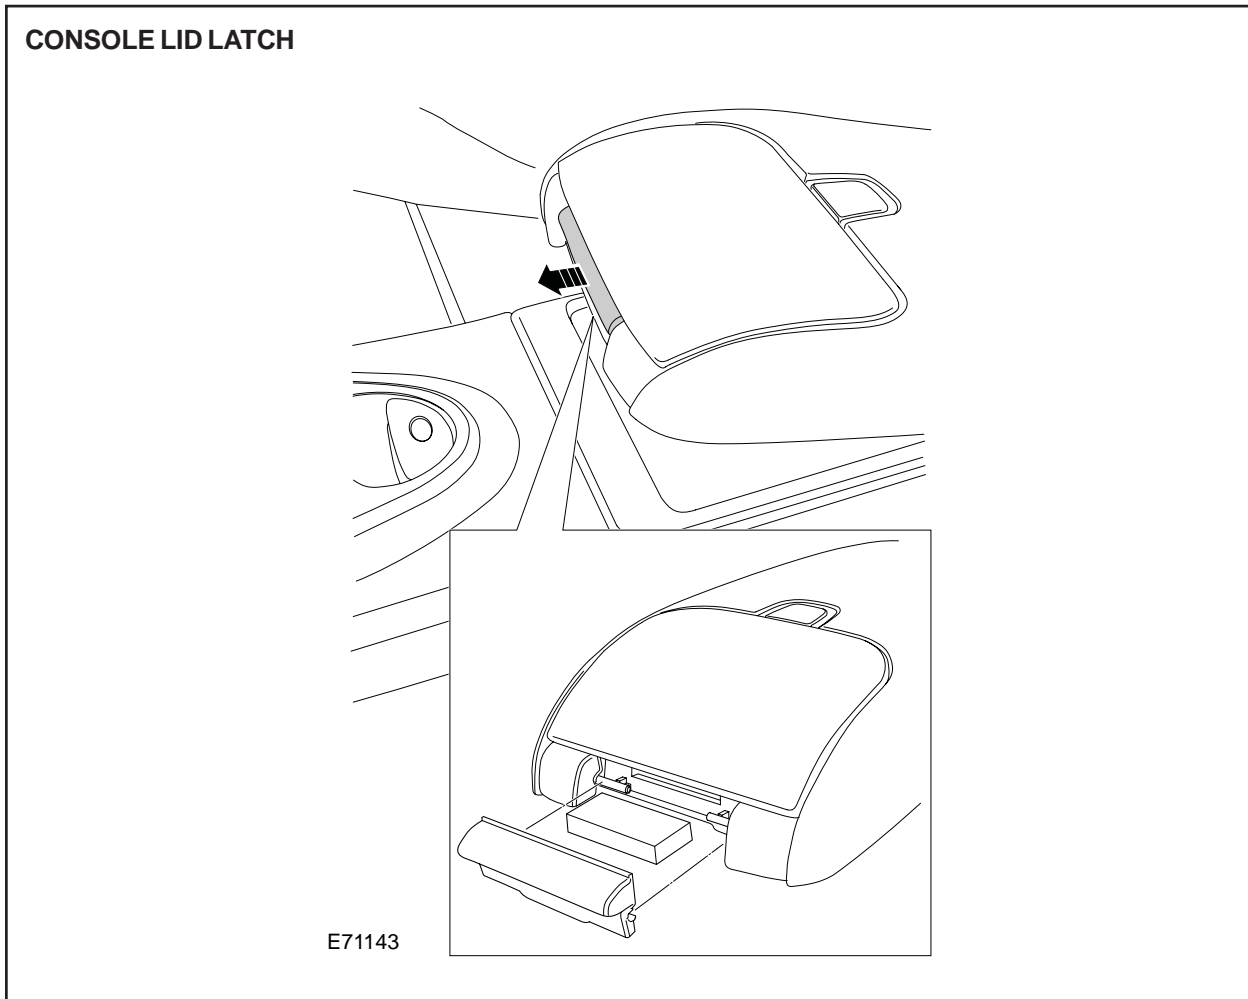


ILLUSTRATION 1

- Remove the foam pad from the console lid.

**Note:** A small amount of Lithium grease can be applied to the foam and handle contacting faces to reduce operation noise and to help prevent the handle sticking.

- Apply the new foam pad to the console lid.
- Install the new console lid latch and secure with the two retaining clips.
- Close the center console lid.

## Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

### Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Latch	C2C 34128	1
Foam	C2C 34127	1

### Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install a new center console lid latch	76.95.02	0.2 hrs.	C2C 34128

**Note:** Repair procedures are under constant review, and therefore repair times are subject to change. The times quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.