

**S-TYPE**

DATE 05/02

S307-06

SERVICE**TECHNICAL BULLETIN**

Difficulty Selecting Range –
Stiff Or Restricted Movement –
Revised Selector Lever Cable

MODEL 2000-02 MY
S-TYPE

VIN L00001-M45255

Issue:

Some owners of 2000-02 MY S-TYPE vehicles may experience difficult range selection, or an inability to start the vehicle.

These conditions can be caused by the following:

- The inner transmission selector lever cable movement is restricted/stiff.
- The outer transmission selector lever cable appears to be moving within the crimped ends.

An improved selector lever cable entered production on later vehicles to solve this condition.

Action:

In case of a customer complaint of the above conditions on a 2000-2002 MY S-TYPE vehicle, install the new improved selector lever cable, available under the existing part number (XR8 33366).

Parts Information:**DESCRIPTION**

Selector lever cable

PART NUMBER

XR8 33366