

Fuel Filler Door Inoperative –
Actuator Binding –
Modification Procedure

MODEL 2005 MY
S-TYPE

VIN N13089-N41136

Issue:

On 2005 S-TYPE vehicles within the above VIN range, when a fault has been confirmed with the fuel filler door actuator, a modification must be carried out on the new actuator before installation on vehicles within the above VIN range.

Cause: Fuel filler door actuator being stressed when installed in housing.

Action:

Before installing, modify the new fuel filler door actuator as follows.

1. Using a suitable craft knife, remove the two small ribs from the fuel filler door actuator (Illustration 1).

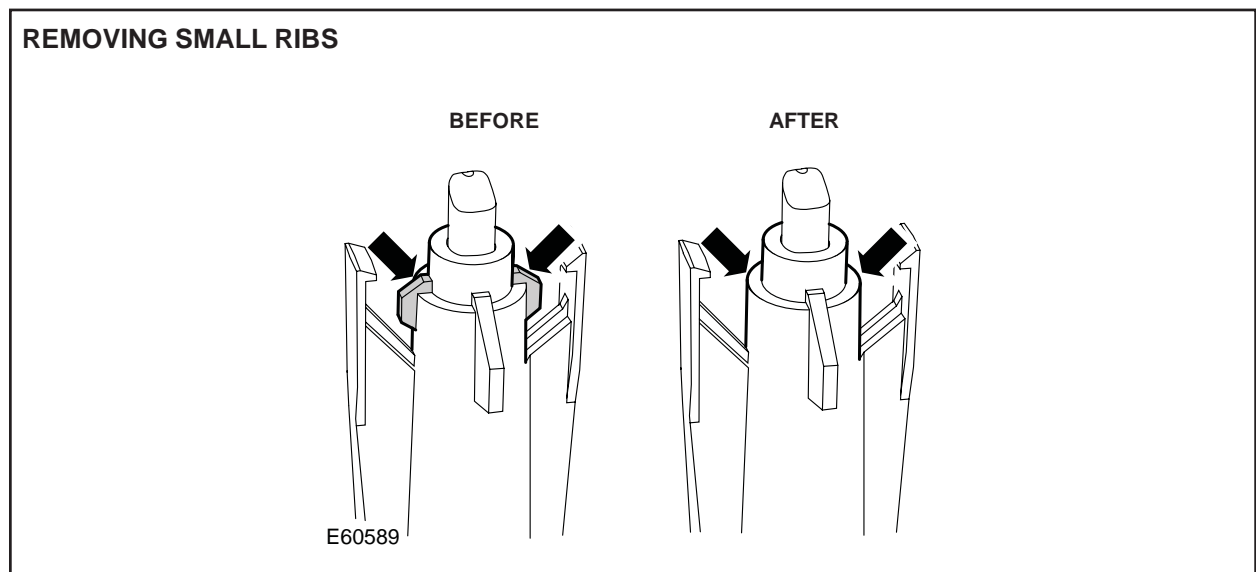


ILLUSTRATION 1

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR DEALER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.

- Using a suitable craft knife, trim the highlighted sections from the two large ribs on the fuel filler door actuator (Illustration 2).

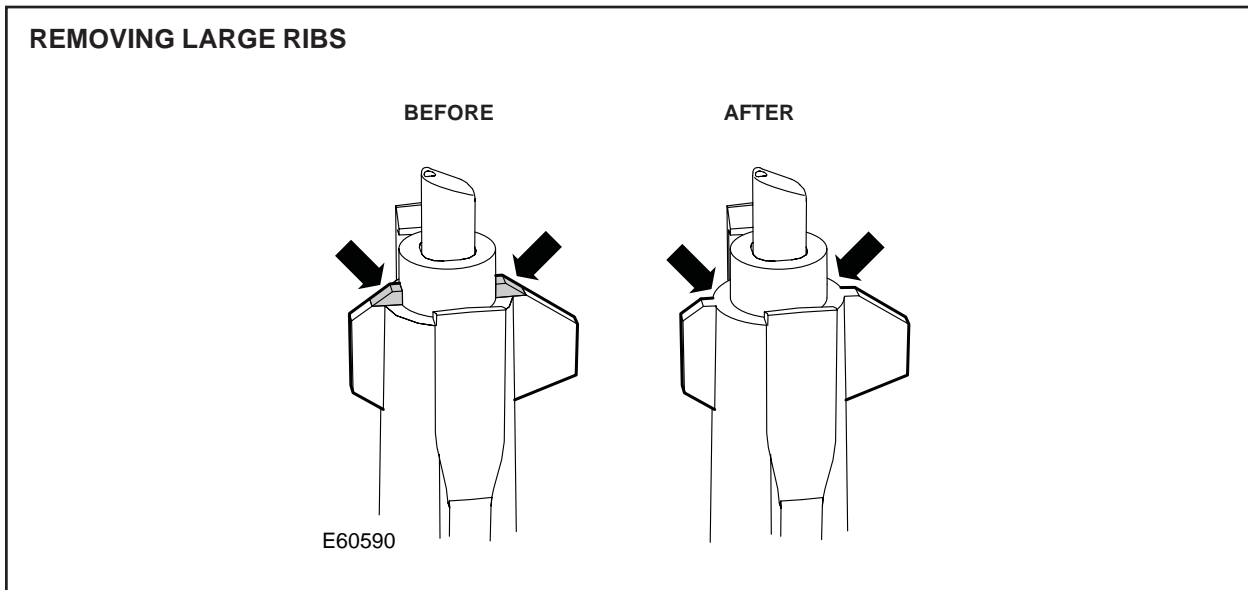


ILLUSTRATION 2

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Fuel filler door actuator	XR8 52060	1

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Modify Fuel Filler Door actuator	76.94.90	0.2 hrs.	XR8 52060

Note: Repair procedures are under constant review, and therefore repair times are subject to change. The times quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.