

Condensation In Headlamps –
Revised Headlamp Cap Available –
Repair Procedure

MODEL 2002-04 MY
X-TYPE

VIN C00001-E06300

Issue:

Some 2002-04 MY X-TYPE vehicles within the above VIN range, may exhibit condensation buildup within the headlamp assemblies. A revised cap for the low beam (outer) headlamp has been released to address this concern.

Action:

In case of a customer concern of condensation buildup within the headlamp assemblies, install a revised low beam (outer) headlamp cap as described in the procedure below.

WORKSHOP PROCEDURE

1. Remove battery (see Workshop Manual, section: 414-01, SRO 86.15.01).
2. Unclip the left-hand-side low beam (outer) headlamp cap and remove cap (Illustration 1, left-hand-side shown, right-hand-side similar).

LOW BEAM HEADLAMP CAP

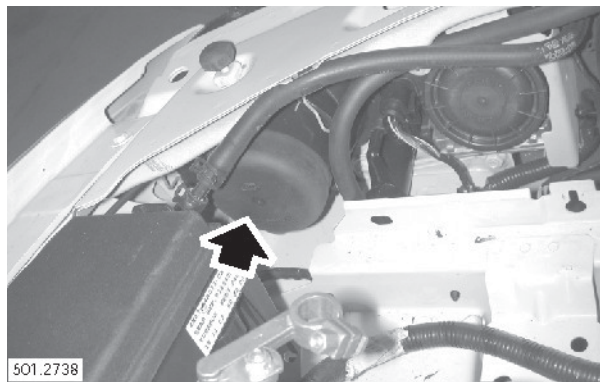


ILLUSTRATION 1

3. Install the new headlamp cap, reposition clips and secure cap.
4. Carry out step 2 and 3 for the right-hand-side headlamp cap.
5. Install battery (see Workshop Manual, section: 414-01, SRO 86.15.01).

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR RETAILER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Headlamp cap (right-hand)	C2S 39577	1
Headlamp cap (left-hand)	C2S 39579	1
Xenon headlamp cap (right-hand)	C2S 39578	1
Xenon headlamp cap (left-hand)	C2S 39580	1

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install new headlamp caps	86.93.44	0.3 Hours	Refer to parts table above