



X-TYPE

DATE 06/05

XT501-32

SERVICE

TECHNICAL BULLETIN

Passenger Seat Heater Intermittent Fault –
Revised Software Level –
Replace Seat Heater Control Switch

MODEL 2002-05 MY
X-TYPE

VIN D80306-E31837

Issue:

Some 2002-05 X-TYPE vehicles within the above VIN range, may exhibit intermittent operation of the front passenger seat heater, especially at low ambients (sub zero °C).

Cause:

Software in the front passenger seat control switch (level 16).

Action:

In case of a customer complaint of the above condition, check if the front passenger seat control switch has level 16 on the label. If so, install a new front passenger seat control switch with software level 17 (see Global Technical Reference GTR Workshop Manual, section 501-10).

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR DEALER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.

Global Technical Reference (GTR) Workshop Manual Information:

Dealer access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Front passenger seat control switch	C2S 40331	1

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install a new front passenger seat control switch	86.75.23	0.6 hrs.	C2S 40331