

Headlamp Washer Jet Cover Pivot Link –
Change Of Specification –
Service Action S940

MODEL 2002-03 MY
X-TYPE

VIN C00294-D29054

Issue:

On vehicles fitted with headlamp power wash, there has been a high incidence of headlamp washer jet cover loss; caused by the detachment of the link that attaches the jet telescope to the washer jet cover.

Action:

At the next available opportunity, replace the link on all 2002-03 MY X-TYPE vehicles, within the above VIN range, that are equipped with headlamp power wash.

Note: This Service Action covers the replacement of the link **only**. Should the headlamp washer jet covers be missing, please refer to Technical Bulletin: **XT501-09**. No claims for the headlamp washer jet covers will be covered under this Service Action.

WORKSHOP PROCEDURE

Working on first headlamp power wash jet:

1. Grip headlamp power wash jet cover with fingers and slowly pull headlamp power wash jet out to its operating position.
2. Remove the cover of the headlamp power-wash jet from the link.
3. Remove the link from headlamp power-wash jet. (Illustration 1)

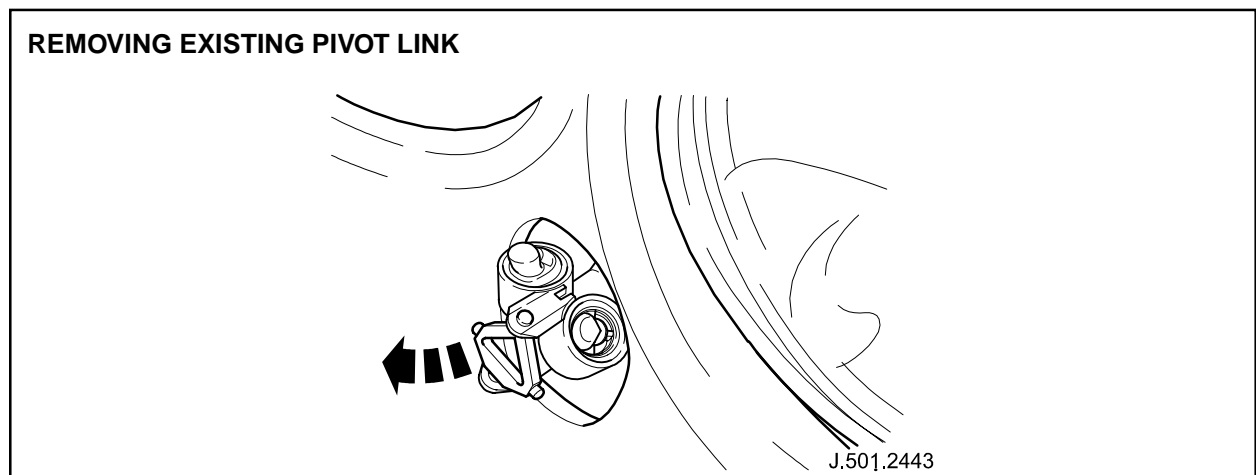


ILLUSTRATION 1

INSTALLING NEW PIVOT LINK

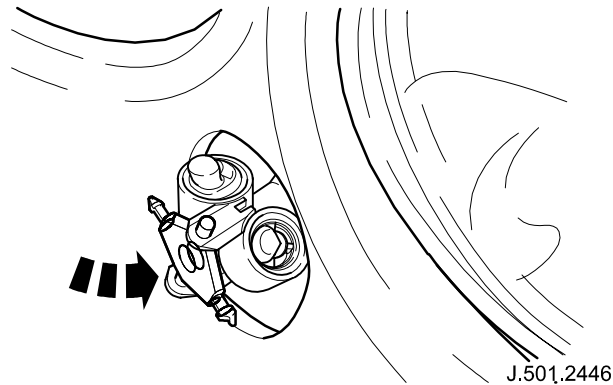


ILLUSTRATION 2

4. Install and seat new link to headlamp power-wash jet (Illustration 2).

Note: New link pegs are offset lowermost when installed for correct seating of cover to bumper.

INSTALLING COVER ON POWER WASH JET

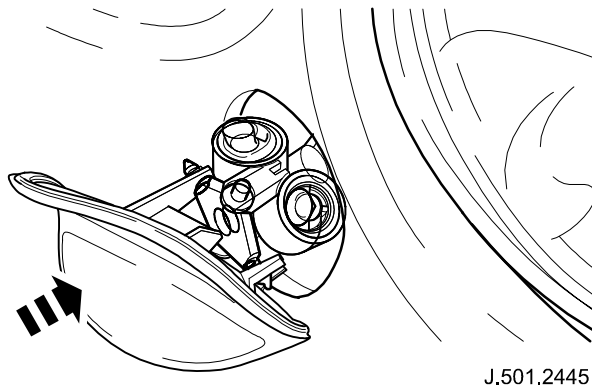


ILLUSTRATION 3

5. Install power wash jet cover to new link (Illustration 3).

Note: Power-wash jet covers are marked on the rear face left hand or right hand.

6. Slowly release headlamp power wash jet to its retracted position.
7. Repeat steps 1 to 6 to install remaining headlamp power-wash jet link.

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Link	C2S 30434	1 per side

Warranty Information:

Warranty claims should be submitted quoting program code S940 together with the relevant option code from the table below.

This will result in payment of the stated time and, where applicable the relevant parts/miscellaneous expense codes.

The options that allow for drive in/drive out can only be claimed when the vehicle has been brought into the workshop for this action alone to be undertaken.

The SROs and parts listed above have been included for information only. There will be no requirement to enter the parts or SROs onto the claim.

Service Action S940

2002 MY 2.5L VIN Range	2XC00294 - 2XC86114
2002 MY 3.0L VIN Range	2WC00294 - 2WC86114
2003 MY 2.5L VIN Range	3XC86115 - 3XD29054
2003 MY 3.0L VIN Range	3WC86115 - 3WD29054

Program Code	Option	Description	SRO	Time	Part Number	Part Description	Qty
S940	B	Replace link	84.91.10	0.2 hrs.	C2S 30434	Link	2
S940	C	Replace link	84.91.10	0.2 hrs.	C2S 30434	Link	2
		Drive in/drive out	10.10.10	0.1 hrs.			

Note: Always review a Vehicle's Claim History within DDW first to determine whether this service action has been previously performed on a specific vehicle. The "Review Claim History" function will display a list of claims against the vehicle. If this service action appears in the program code field, do not perform this service action.