



MODEL
2007 XK

DATE
06 Apr 2006

NUMBER
XK419-001

SERVICE

TECHNICAL BULLETIN

SECTION: 419-07

MPH Reset for Navigation Screen

AFFECTED VEHICLE RANGE:

New XK

VIN: B00001 onwards

Model Year: 2007 onwards

CONDITION SUMMARY:

PROCEDURE TO RESET NAVIGATION SYSTEM UNITS

This bulletin has been issued to inform dealers of a potential Navigation Screen display error. Some vehicle Navigation Screens may display metric units, when the instrument cluster displays English units. A Navigation System software error may be the cause. An incorrect unit display can occur following a battery reset or software download. The software error can be corrected through the touch screen.



NOTE: A post-launch software update will correct this error.

Situation: Navigation System software error results in incorrect units of measure display.

Action: Should a vehicle Navigation Screen display metric units, while the instrument cluster displays English units, refer to the Repair Procedure detailed in this bulletin to manually reset the navigation system software to compute and display English units.

PARTS:

No parts required. Information purposes only.

WARRANTY:



NOTE: The manual Navigation System resetting procedure is covered in the PDI so this manual navigation system resetting procedure can only be claimed for a battery reset or software download after completing the vehicle PDI.



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

<i>Description</i>	<i>SRO</i>	<i>Time (Hours)</i>	<i>Condition Code</i>	<i>Causal Part</i>
Manually reset satellite navigation system	86.93.63	0.20	(as required)	C2P4480

Normal warranty policy and procedures apply.

**NOTE: The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers."
If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether the bulletin applies to a specific vehicle.**



TECHNICAL BULLETIN

NUMBER
XK419-001

REPAIR PROCEDURE

MANUALLY RESET NAVIGATION SYSTEM SOFTWARE TO COMPUTE AND DISPLAY ENGLISH UNITS

1. From the Navigation System home screen, select 'Vehicle'.
2. Select 'Trip Comp'.
3. Select 'Units'.
4. Select and hold 'KM' for 15 seconds.
5. Select 'Miles'.
6. Return to Navigation screen and confirm changes.