

# TECHNICAL BULLETIN



## Driver's Seat and Mirrors Control Module – Loss of Seat or Mirror Functions – Repair Procedure

# 86-148

MODEL Sedan Range 1994 MY

DATE 4/95

VIN 687219 - 701123

### ISSUE:

Loss of any driver seat adjustment function, door mirror adjustment function, or any combination of seat and mirror adjustment functions in 1994 MY Sedan Range vehicles from VIN 687219 - 701123, may be caused by a failure of the driver's seat and mirrors control module (ECM). If a function fails, it would cause the adjustment controlled by that function to remain at its last position. To prevent repeat failure of the ECM, perform the following action.

### ACTION:

If the driver's seat and mirrors control module fails on a 1994 MY Sedan Range vehicle within the VIN range listed above, BOTH door mirrors must be replaced with revised mirror units (left mirror, part number HMD 3043AC) (right mirror, part number HMD 3042CC) when the ECM is replaced.

NOTE: A production change within the VIN range added capacitors to the door mirror motors. The capacitors, which were added to reduce radio interference, may induce an electrical resonance in the mirror circuit causing ECM failure.

The supply of revised door mirrors is limited. Use revised mirrors ONLY on vehicles that have a failure of the control module.

### PARTS INFORMATION:

Do not order revised mirrors for dealer stock. Please order on a VOR basis only.

<u>DESCRIPTION</u>	<u>PART NO.</u>	<u>QTY</u>
Driver's seat and mirrors control module	LHB 2165AA	1
Door mirror - left side	HMD 3043AC	1
Door mirror - right side	HMD 3042CC	1

### WARRANTY INFORMATION:

<u>FAULT CODE</u>	<u>R.O. NUMBER</u>	<u>DESCRIPTION</u>	<u>TIME ALLOWANCE</u>
SX CC JY	86.75.15.09	Driver seat/mirror ECM - Renew (w/out JDS test)	0.15 hrs.
WH BB RN	76.10.52.09	Door mirror, driver - Renew (w/out JDS test)	0.35 hrs
WH DB RN	76.10.52.09	Door mirror, passenger - Renew (w/out JDS test)	0.35 hrs