

# TECHNICAL BULLETIN



## Seat Control Module – Loss of Seat or Mirror Functions – Repair Procedure

# 86-159

MODEL XJS Range 1994 MY

DATE 7/95

VIN 190528 - 192880

### ISSUE:

Loss of any driver seat adjustment, door mirror adjustment, or any combination of seat and mirror adjustments in 1994 MY XJS Range vehicles from VIN 190528 - 192880, may be caused by a failure of the seat control module (SCM). If a function fails, it would cause the adjustment that it controls to remain at its last set position. To prevent repeat failure of the SCM, the mirrors must also be replaced.

### ACTION:

If the seat control module fails on a 1994 MY XJS Range vehicle within the VIN range listed above, BOTH door mirrors must be replaced with revised mirror units when the SCM is replaced.

**NOTE:** A production change within the VIN range added capacitors to the door mirror motors. The capacitors, which were added to reduce radio interference, may induce an electrical resonance in the mirror circuit causing SCM failure.

### PARTS INFORMATION:

<u>DESCRIPTION</u>	<u>PART NO.</u>	<u>QTY</u>
Seat control module (SCM)	LHB 2165AA	1
Door mirror - left side (chrome)	HHE 3043AA	1
Door mirror - left side (primed)	HHC 3043AB/XXX	1
Door mirror - right side (chrome)	HHE 3042CA	1
Door mirror - right side (primed)	HHC 3042CB/XXX	1

### WARRANTY INFORMATION:

<u>FAULT CODE</u>	<u>R.O. NUMBER</u>	<u>DESCRIPTION</u>	<u>TIME ALLOWANCE</u>
SX CC JY	86.75.15.09	SCM - Replace (w/out JDS test)	0.15 hrs.
WH BB RN	76.10.52.09	Door mirror, driver - Replace (w/out JDS test)	0.30 hrs
WH DB RN	76.10.52.09	Door mirror, passenger - Replace (w/out JDS test)	0.30 hrs