



Sedan Range

DATE 12/94

13-18

SERVICE

TECHNICAL BULLETIN

Rocker Panel Blackout Area – Repaint – Service Action S616

MODEL 1995 MY
Sedan Range
VIN 720001-727823

ISSUE:

Matte black paint may be missing from the blackout area of the rocker panels (lower sill flanges) following “KATS removal on 1995 MY Sedan Range vehicles from VIN 720001 - 727823.

The high pressure cold water spray used to wash off the “KATS Remover solution may dislodge sections of the matte black paint in rocker panel area.

ACTION:

Following “KATS” removal on Sedan Range vehicles within the VIN range above, inspect the rocker panel blackout areas (Illustration 1). If matte black paint is missing or damaged, perform the following procedure.

NOTE: Repairs should be performed during dealer PDI.

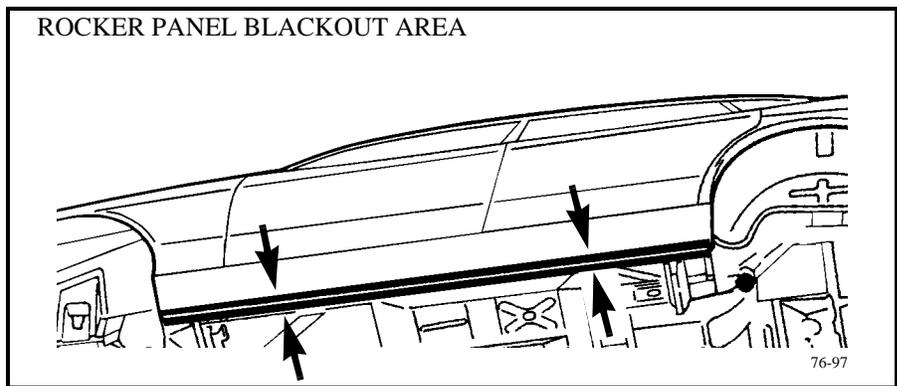


ILLUSTRATION 1

BLACKOUT AREA REPAIR PROCEDURE

1. Thoroughly wash the area with a paint preparation solvent.
2. Mask and repaint with an air drying matte black paint.

PARTS INFORMATION:

No parts required. Source required materials locally

WARRANTY INFORMATION:

Service Action S616

<u>VEHICLE</u>	<u>SUMMARY CODE</u>	<u>DESCRIPTION</u>	<u>TIME ALLOWANCE</u>
Sedan Range 1995 MY From VIN 720001 - 727823	ET	Repaint blackout area	0.25 hrs.

CLAIM SUBMISSION PROCEDURE:

Warranty summary codes have been assigned to this service action in order to simplify claim submission. The dealership will be reimbursed the labor time allowance and \$1.50 for shop supplies.

DCS Dealers

Submit claims using the appropriate summary code for the vehicle model and work performed. Follow standard campaign submission procedures.

Non-DCS Dealers

Submit claims on the Recall Campaign Summary form W-25. Enter the appropriate summary code for the vehicle model and work performed in the Repair Code column. Do not use the W-1 warranty claim form.