

Intermittent No Crank -  
Starter Cable Loose at Bulkhead Terminal -  
Check Terminal Torque

MODEL 1995-96 MY  
Sedan Range  
VIN  
720001-778598

**ISSUE:**

Some 1995-96 MY Sedan Range vehicles within the above VIN range may experience an intermittent no crank condition. The condition can be caused by a starter link cable that is loose at the bulkhead terminal (ST3/ST5).

**ACTION:**

When investigating a customer complaint of an intermittent no crank condition, check the bulkhead terminal (ST3/ST5) for looseness (Illustration 1).

1. Disconnect the battery negative cable.
2. Pull up the rubber cap and torque the nut to 62 - 88.5 lbs. in. (7 - 10 Nm.) to ensure a tight connection.
3. Reconnect the battery and reset the clock.

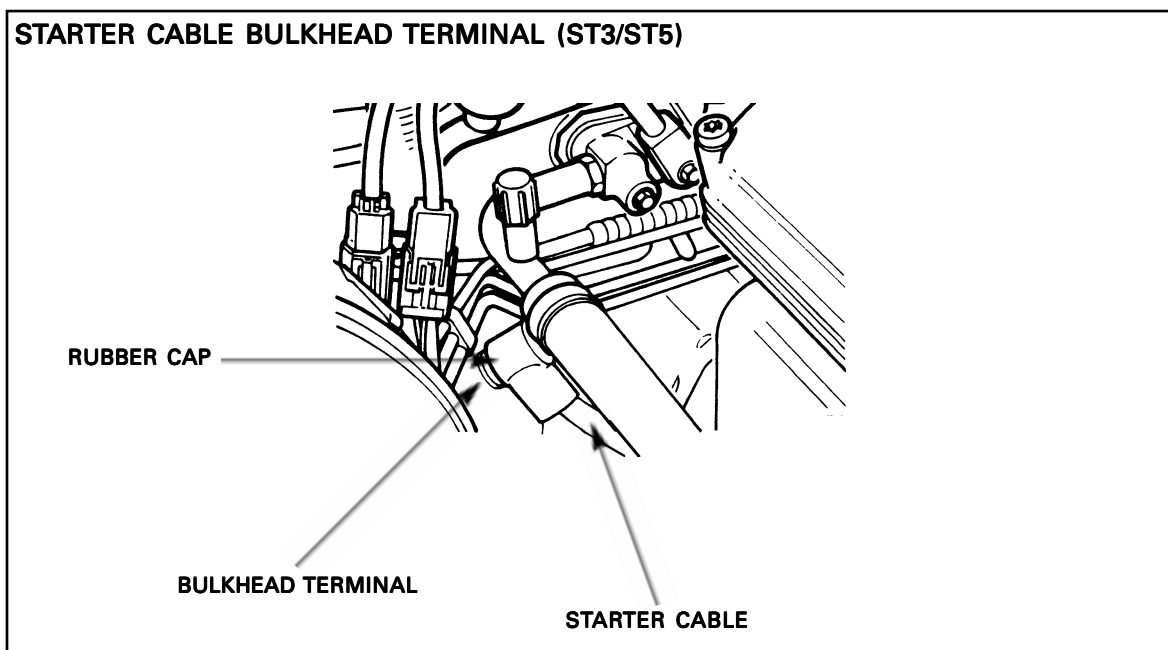


ILLUSTRATION 1

**PARTS INFORMATION:**

DESCRIPTION

Nut

PART NUMBER

FN 108041/J

QTY

1

**WARRANTY INFORMATION:**

**FAULT**

**CODE**

LL FH FZ

**R.O.**

**NUMBER**

86.92.10

DESCRIPTION

Torque starter cable nut

**TIME**

**ALLOWANCE**

0.15 hrs.