

Squeaks & Rattles – Noise from Traction Control Actuator – Install Isolating Pads

MODEL 1995 MY
Sedan Range
VIN 720001 - 734054

ISSUE:

Some Sedan Range vehicles, within the above VIN range, equipped with traction control may experience a noise that the customer reports as coming from the right side of the fascia. The source of the noise may actually be in the engine compartment and be caused by vibration of the traction control actuator on its mounting.

Starting with VIN 734055, foam isolating pads are installed between the traction control actuator and its bracket.

ACTION:

After verifying that the actual source of a customer complaint of fascia noise is the traction control actuator, proceed as follows:

ADDING ISOLATING STRIPS TO TRACTION CONTROL UNIT MOUNTING

1. Loosen the two screws that secure the traction control actuator on its mounting bracket.
2. Cut two 25/64 in. (10 mm.) wide strips from a closed cell foam pad.
3. Raise the actuator and insert the two strips between the mounting bracket and the actuator as shown in Illustration 1.

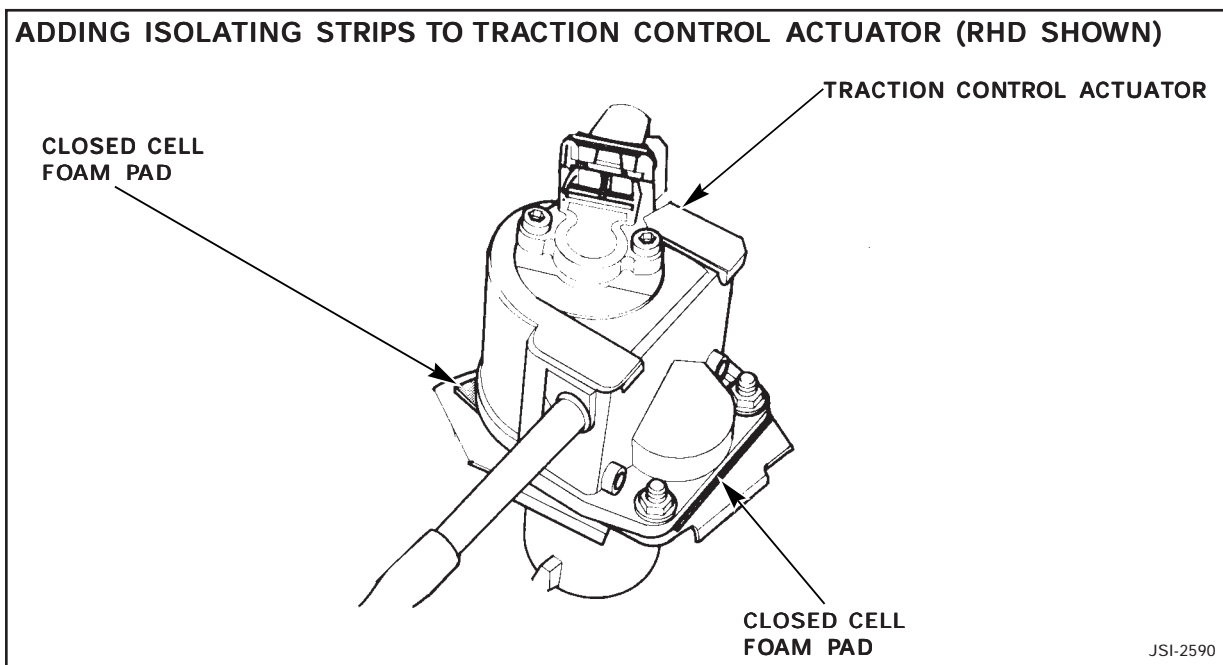


ILLUSTRATION 1

4. Retighten the two mounting screws.

NOTE: Refer also to Technical Bulletin 19.6-03.

PARTS INFORMATION:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Foam pad (closed cell)	HNA 1210BA	1

WARRANTY INFORMATION:

<u>FAULT CODE</u>	<u>R.O. NUMBER</u>	<u>DESCRIPTION</u>	<u>TIME ALLOWANCE</u>
HG LF MS	76.92.87	Install foam pads	0.10 hrs.