

**Squeaks & Rattles – Noise from  
PAS Reservoir – Adjust Mounting**

MODEL 1995 MY  
Sedan Range  
VIN 720001-740691

**ISSUE:**

Some 1995 MY Sedan Range vehicles within the above VIN range may exhibit a noise from the right side of the fascia/bulkhead/underhood area.

The noise can be caused by contact between the cap of the power assisted steering (PAS) fluid reservoir and the hood insulating lining.

The reservoir location was modified starting with VIN 740692.

**ACTION:**

Only in case of a customer complaint of noise as described above on a 1995 MY Sedan Range vehicles within the above VIN range, perform the following procedure:

1. Remove the toolbox assembly.
2. Loosen the clamp bolt (Illustration 1) that retains the PAS reservoir in the mounting bracket.

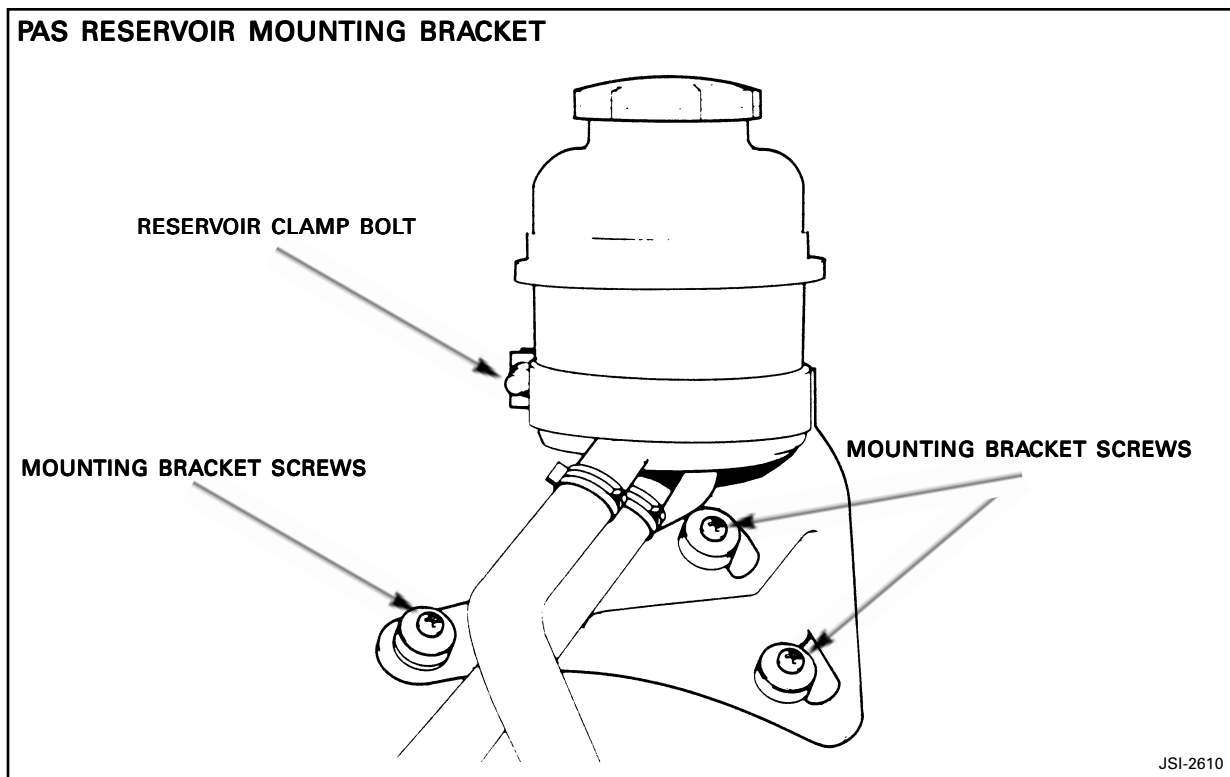


ILLUSTRATION 1

3. Raise the reservoir to allow access to the screws (Illustration 1) that secure the bracket to the inner fender well.
4. Loosen the mounting bracket screws.
5. Push the mounting bracket down as far as it will go. Tighten the screws while holding the mounting bracket down as far as possible.
6. Push the reservoir down into the mounting bracket and tighten the clamp bolt. The reservoir should now be seated as low as possible in the mounting bracket.
7. Reinstall the toolbox assembly.

**NOTE:** When installing the toolbox assembly, ensure that the traction control primary cable is centered in the slot in the toolbox as shown in Technical Bulletin 19.6-03.

**WARRANTY INFORMATION:**

<b>FAULT</b>	<b>R.O.</b>		<b>TIME</b>
<b><u>CODE</u></b>	<b><u>NUMBER</u></b>	<b><u>DESCRIPTION</u></b>	<b><u>ALLOWANCE</u></b>
GC BB MS	76.92.93	Reposition PAS reservoir	0.15 hrs.
	10.10.10	Drive in/drive out	0.15 hrs.

