

**Clicking Noise From Front of Vehicle –  
Brake Disc Dust Shield – Install Revised  
Dust Shield****MODEL** 1995-96 MY  
Sedan Range  
**VIN**  
720001-ON**ISSUE:**

Some 1995-96 MY Sedan Range vehicles equipped with 16 inch alloy wheels **and** accessory dust shields (Illustration 1) may experience a clicking noise from the front of the vehicle at low speeds. The noise may be caused by one dust shield rubbing against the alloy wheel.

**ACTION:**

After verifying a customer complaint of clicking from the front of the vehicle, determine on which side of vehicle the noise is apparent. Replace the dust shield on that wheel with a revised dust shield. In addition to the part number label, the revised dust shield can be identified by a wider flange with foam rubber blocks attached.

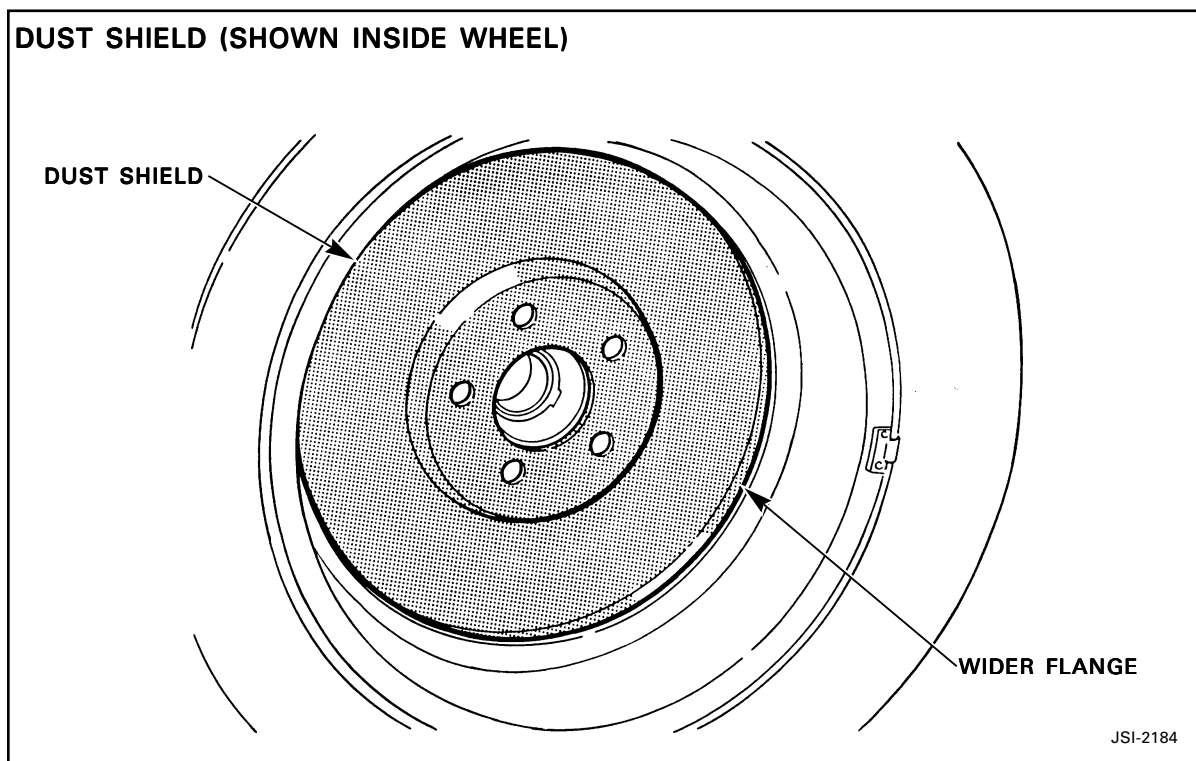


ILLUSTRATION 1

## PARTS INFORMATION:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Brake disc dust shield	MNA 1803AA	1

## WARRANTY INFORMATION:

<u>FAULT CODE</u>	<u>R.O. NUMBER</u>	<u>DESCRIPTION</u>	<u>TIME ALLOWANCE</u>
GH FR CL	74.20.05	Replace dust shield	0.20 hrs.