



S-TYPE

DATE 10/04

S501-S164

SERVICE

TECHNICAL BULLETIN

Rain Sensing Wipers –
Remove Diode/Install 5 Amp Fuse –
Service Action S164

MODEL 2005 MY
S-TYPE
VIN N13089-N25488

Issue:

A concern has been identified on a number of 2005 S-TYPE vehicles within the above VIN range. Vehicles equipped with rain sensing wiper control may mistakenly have a diode installed in location D1 of the front power distribution fuse box (located in the engine compartment) instead of the 5 amp fuse that should be in this location.

Action:

Use DDW to determine vehicle eligibility prior to confirming work requirements as some vehicles within the above VIN range have been reworked prior to dispatch. DDW has been updated so that only those vehicles still affected by this Service Action will be displayed.

All unsold vehicles must be reworked before retail sale.

Vehicles in the hands of a customer should be repaired at the earliest opportunity.

NOTE: The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers." Do not assume that a condition described affects your car. Contact a Jaguar retailer to determine whether the Bulletin applies to your vehicle.

If a diode is present in location D1, Illustration 1, replace it with a 5 amp fuse. If a 5 amp fuse is present, no further action is required.

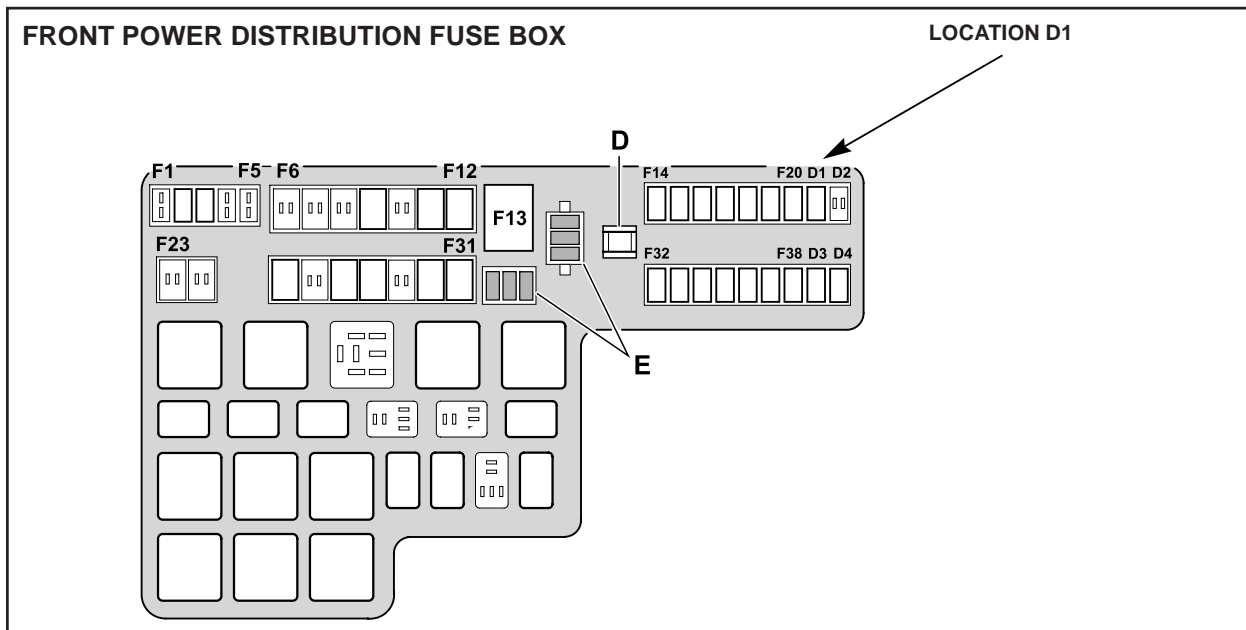


ILLUSTRATION 1

At the time of confirming the appointment for vehicle repair or service, please ensure that all outstanding Field Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Parts Information:

DESCRIPTION
5 amp fuse

PART NUMBER
C2S 25670

QTY
1

Warranty Information:

Warranty claims should be submitted quoting program code S164 together with the appropriate option code from the table below. This will result in payment of the appropriate labor time and payment for any parts consumed.

The options that allow for the drive in/drive out allowance can only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Service Action S164

Year	Model	VIN range
2005 MY	3.0 L	5F N13089 - 5F N25488
2005 MY	4.2 L	5H N13089 - 5H N25488
2005 MY	3.0 L	51 N13089 - 51 N25488

Program Code	Option	Description	SRO	Time	Part Number	Part Description	Qty
S164	A	Inspect fuse position D1 – no further action required	10.10.99	0.2 hrs.	-	-	-
S164	B	Inspect fuse position D1 – no further action required	10.10.99	0.2 hrs.	-	-	-
		Drive in/Drive out	10.10.10	0.1 hrs.			
S164	C	Inspect fuse position D1, remove diode & insert 5amp fuse	10.10.99	0.2 hrs.	C2S 25670	5 amp fuse	1
S164	D	Inspect fuse position D1, remove diode & insert 5amp fuse	10.10.99	0.2 hrs.	C2S 25670	5 amp fuse	1
		Drive in/Drive out	10.10.10	0.1 hrs.			

NOTE: Always perform a DDW claim search first to determine whether this service action has been performed on this vehicle. The "Review Claim History" function will provide a listing of all claims against the vehicle. If this service action number appears in the program code field, do not perform this service action.