

Special Tool 206-066A –
Does Not Fit Revised Hub Assembly –
Modification Procedure

MODEL 2005 MY-ON
XKR

VIN A41332-ON

Issue:

Special tool 206-066A (anti-lock brake system (ABS) rotor nut socket) will no longer fit XK supercharged vehicles from the above VIN, due to running changes to the hub assembly.

A simple modification must be carried out on special tool 206-066A to allow it to fit later production vehicles. This modification will not affect the tool's current usage or warranty.

Action:

Modify special tool 206-066A as described below:

1. Measure 13 mm (0.51 in.) from the end of the tube and mark a line all the way around the tube (Illustration 1). Place the special tool 206-066A in a vise and use a suitable hacksaw remove the 13 mm (0.51 in.) of material from the tube.

Note: Dress the cut face using a suitable file and remove rough edges.

MATERIAL TO BE REMOVED FROM TOOL 206-066A

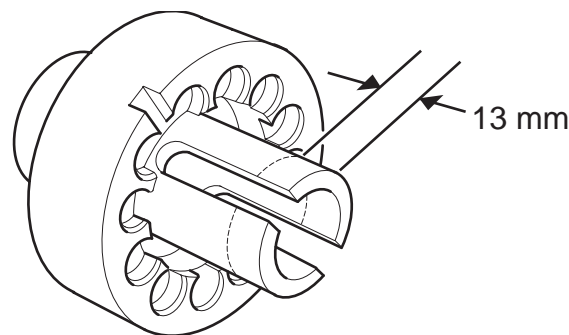


ILLUSTRATION 1

NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR RETAILER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.