

Front Wheel Hub – Accumulation Of Excess Grease – Grease Deflector Ring

MODEL

1997 MY-ON XK8 Range

1998 MY-ON V8 Sedan NA

VIN

018108-ON

812256-ON

Issue:

Vehicles after the above VIN are equipped with a nylon grease deflector ring on the rotor nut of each front hub. This ring prevents the build-up of excess grease near the seal which could collect dirt that could damage the seal.

Action:

When performing a repair on a 1997 MY-on XK8 that requires removing the rotor nut, install a grease deflector ring during reassembly. 1998 MY-on vehicles must always have the deflector ring reinstalled during any service to the front hub.

The deflector ring is a light interference fit on the nut and must be installed 0.5 mm from the edge of the hub as shown in Illustration 1.

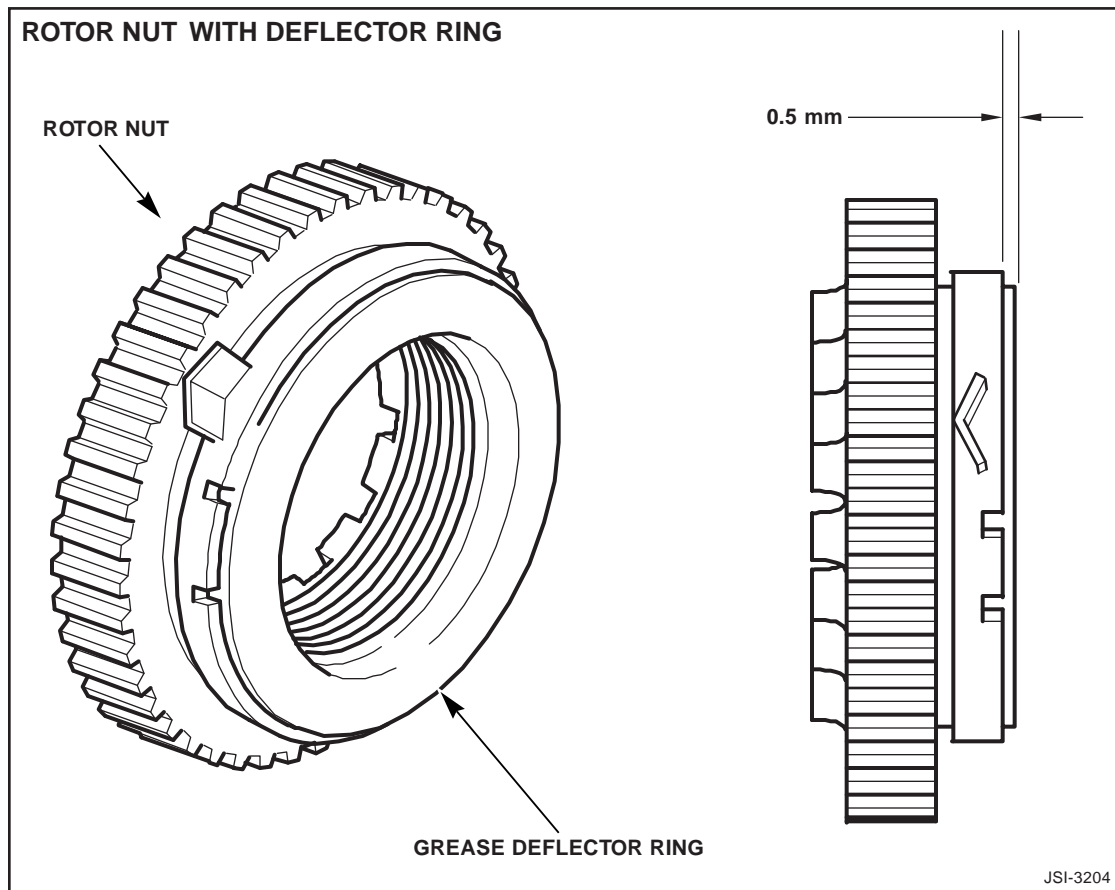


ILLUSTRATION 1

Parts Information:

DESCRIPTION

Deflector ring

PART NUMBER

MJA 1846AA

QTY

1