

**Replacement Stabilizer Bar Bushings –  
Lubricate Before Installing**

**MODEL**  
1997 MY-ON XK Range  
1998 MY-ON V8 XJ Series  
**VIN**  
001001-ON  
812256-ON

**Issue:**

When replacing stabilizer bar bushings on XK Range and V8 XJ Series vehicles, the specified grease must be applied to the replacement bushings.

**Action:**

When replacing the front or rear stabilizer bar mounting bushings, apply Castrol NTR grease part no. 10558 to the inner face of the bushing. This action is required to allow free movement of the stabilizer bar within the bushings.

**⚠ Caution:** When applying the grease make sure that only the inner face of the bushings is coated with the grease. Grease applied to the outer face of the bushings will affect the retention of the bushing by the retaining brackets.

For both XJ series vehicles and XK series vehicles refer to the Workshop Manual, JTIS CD ROM section 204-01, SRO 60.10.04, for stabilizer bar bushing replacement (referred to as “mounting rubber” for V8 XJ Series).

**FRONT STABILIZER BAR BUSHING**

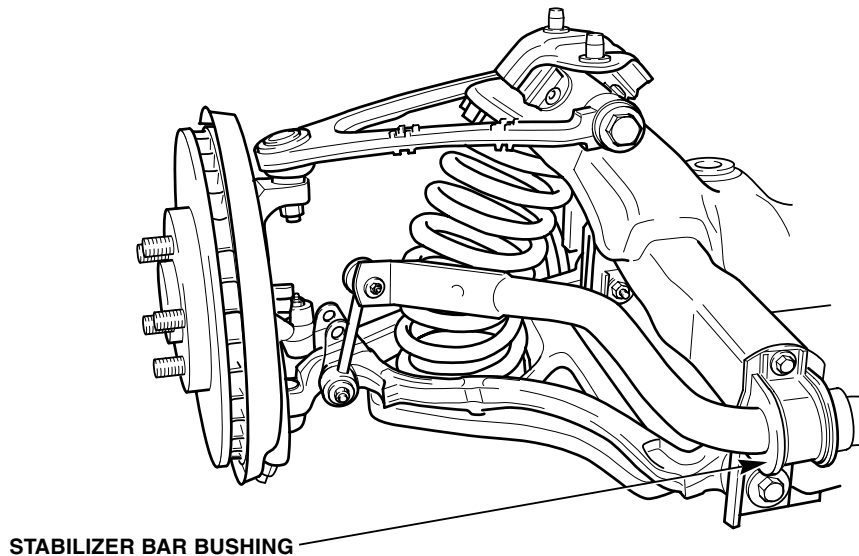


ILLUSTRATION 1

**Parts Information:**

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Castrol NTR grease	10558	1KG*

\* will service approx. 260 cars

**Warranty Information:**

A sublet amount of \$1.00 per vehicle can be claimed for grease.